



DIAGRAMA DE CONEXIUNI



| | | | | | | | |
|--|-----------------------------------|--|--------------|-----------|-------------|-------------------|--------|
| 01 | Emis pentru Construire | 03.2019 | M.PANTILICA | M. SCURTU | | | |
| 00 | Prima revizie | 12.2018 | M. PANTILICA | M. SCURTU | | | |
| Rev. | Denumirea modificarii | Data | Intocmit | Verificat | Desen - Nr. | Rev. | |
| | | | | | | | |
| <div><div>RIA ENGINEERING & CONSULTING 107065 BERTEA, SAT BERTEA, 912 100075, PLOIESTI, IL CARAGIALE 49 TELEFON: +40 244 471 659 email: office@riaengineering.ro Engineering & Consulting</div></div> | | <div><div>CONPET S.A. Sitr. Anul 1848, nr. 1-3, 100559, PLOIESTI,</div></div> | | B.031.007 | | IN-WCD-206 | 01 |
| Beneficiar | CONPET S.A. | | | | | Specialitate doc. | F |
| Instalatie | STATIE DE POMPARE POTLOGI | | | | | INSTRUMENTATIE | 3 |
| Scara | Denumire desen | | | | | FAZA | |
| - | DIAGRAMA CONEXIUNI INSTRUMENTATIE | | | | | Pag. 1/7 | PT. DE |

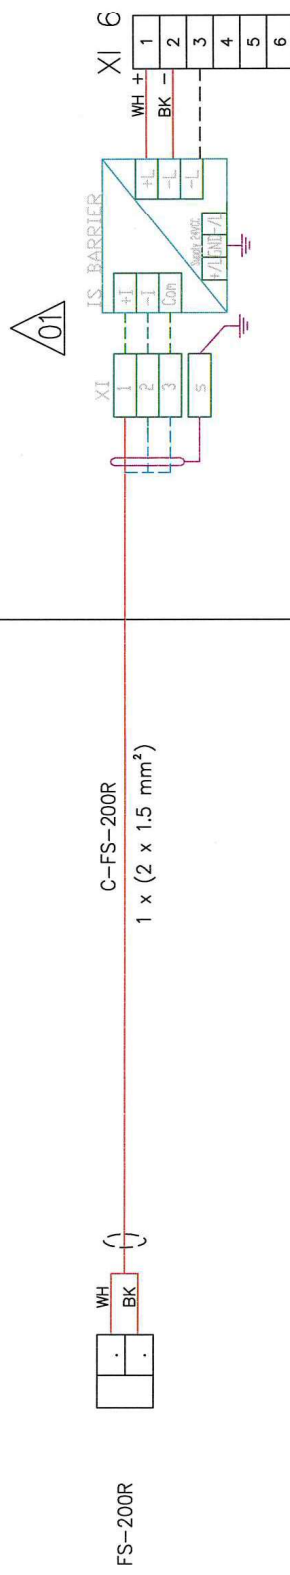
PANOU LOCAL PL-AMC





| | |
|----|-------|
| WH | ALB |
| BK | NEGRU |

| | | | | | | | |
|------------|---|--|-------------|-------------------|--------------|-----------|--------|
| 01 | Emis pentru Construire | | | 03.2019 | M.PANTILICA | M. SCURTU | 43 |
| 00 | Prima revizie | | | 12.2018 | M. PANTILICA | M. SCURTU | |
| Rev. | Denumirea modificării | | | Data | Intocmit | Verificat | |
| |  RIA ENGINEERING & CONSULTING 107065 BERTEA, SAT BERTEA, 492 100015, PLOIESTI, L. CARAGIALE 819 TELEFON: +40 244 471 659 email: office@riengineering.ro |  CONPET S.A. Str. And 1848, nr. 1-3, 100559, PLOIESTI, | Nr. proiect | Desen - Nr. | | Rev. | |
| | | | B.031.007 | IN-WCD-206 | | 01 | |
| Beneficiar | CONPET S.A. | | | Specialitate doc. | | F | |
| Instalatie | STATIE DE POMPARE POTLOGI | | | INSTRUMENTATIE | | 3 | |
| Scara | Denumire desen | | | FAZA | | | |
| - | DIAGRAMA CONEXIUNI INSTRUMENTATIE | | | Pag.3/7 | | | P10-DE |

PANOU LOCAL PL-AMC



| | |
|----|-------|
| WH | ALB |
| BK | NEGRU |

| | | | | | | |
|------------|---|---|----------------|-------------------|-----------|--|
| 01 | Emis pentru Construire | | 03.2019 | M.PANTILICA | M. SCURTU | |
| 00 | Prima revizie | | 12.2018 | M. PANTILICA | M. SCURTU | |
| Rev. | Denumirea modificarii | | Data | Intocmit | Verificat | |
| |  <p>ETA Engineering & Consulting</p> | <p>RIA ENGINEERING & CONSULTING 107065 BERTEA, SAT BERTEA, M2 100015, PLOESTI, L. CARAGIALE 49 TELEFON: +40 244 471 659 email: office@engineering.ro</p> <p> CONPET S.A. Str. Anul 1848, nr. 1-3, 100559, PLOESTI,</p> | Nr. proiect | Desen - Nr. | Rev. | |
| | | | B.031.007 | IN-WCD-206 | 01 | |
| Beneficiar | CONPET S.A. | | | Specialitate doc. | F | |
| Instalatie | STATIE DE POMPARE POTLOGI | | | INSTRUMENTATIE | 3 | |
| Scara | | | Denumire desen | | FAZA | |
| - | DIAGRAMA CONEXIUNI INSTRUMENTATIE | | Pag. 4 / 7 | | PAGE | |

| | | | |
|--|--|---|--|
| PANOU LOCAL PL-AMC | | TE TABLOU ELECTRIC | |
| EEx-e | | EEx-e | |
| <div><div><div>CNO-P-100A In functie/Oprit</div><div>CNO-P-100A Defect</div><div>CNO-P-100A Local/Distanta</div><div>CNO-P-100A Disponibil/Indisponibil</div><div>CNO-P-100A Defect temperatura motor</div></div><div><div>XI 2</div><div><div>7</div><div>WH 1</div></div><div><div>8</div><div>WH 2</div></div><div><div>9</div><div>WH 3</div></div><div><div>10</div><div>WH 4</div></div><div><div>11</div><div>WH 5</div></div><div><div>12</div><div>WH COM</div></div></div><div><div>C-X-002</div><div>6 x 1 mm²</div></div></div> | | <div><div><div>XI 2</div><div><div>1</div><div>WH</div></div><div><div>2</div><div>WH</div></div><div><div>3</div><div>WH</div></div><div><div>4</div><div>WH</div></div><div><div>5</div><div>WH</div></div><div><div>COM WH</div><div>20</div></div></div></div> <div><div>CNO-P-100R In functie/Oprit</div><div>CNO-P-100R Defect</div><div>CNO-P-100R Local/Distanta</div><div>CNO-P-100R Disponibil/Indisponibil</div><div>CNO-P-100R Defect temperatura motor</div></div> <div><div>XI 2</div><div><div>17</div><div>WH 1</div></div><div><div>18</div><div>WH 2</div></div><div><div>19</div><div>WH 3</div></div><div><div>20</div><div>WH 4</div></div><div><div>21</div><div>WH 5</div></div><div><div>22</div><div>WH COM</div></div></div> <div><div>C-X-003</div><div>6 x 1 mm²</div></div> | |
| <div><div>DEFECT INTRERUPATOR GENERAL XI-006</div><div><div>XI 2</div><div><div>1</div><div>WH</div></div><div><div>2</div><div>BK</div></div></div><div><div>C-X-001</div><div>6 x (2 x 1 mm²)</div></div></div> | | <div><div><div>XI 2</div><div><div>3</div><div>WH</div></div><div><div>4</div><div>BK</div></div></div></div> | |
| COD CULORI | | <div><div>01</div><div>Emis pentru Construire</div><div>03.2019</div><div>M. PANTILICA</div><div>M. SCURTU</div></div> <div><div>00</div><div>Prima revizie</div><div>12.2018</div><div>M. PANTILICA</div><div>M. SCURTU</div></div> <div><div>Rev.</div><div>Denumirea modificarii</div><div>Data</div><div>Intocmit</div><div>Verificat</div></div> <div><div><div>TA</div><div>RIA ENGINEERING & CONSULTING</div><div>100055, PLOESTI, L. CARAGIALE 49</div><div>TELEFON: +40 244 471 659</div><div>email: office@riengineering.ro</div></div><div><div>CONPET</div><div>CONPET S.A.</div><div>SIR. Anul 1948, nr. 1-3,</div><div>100559, PLOESTI.</div></div><div><div>Nr. proiect</div><div>Desen - Nr.</div><div>Rev.</div></div><div><div>B.031.007</div><div>IN-WCD-206</div><div>01</div></div><div><div>Beneficiar</div><div>CONPET S.A.</div><div>Specialitate doc.</div><div>F</div></div><div><div>Instalatie</div><div>STATIE DE POMPARE POTLOGI</div><div>INSTRUMENTATIE</div><div>3</div></div><div><div>Scara</div><div>Denumire desen</div><div>FAZA</div></div><div><div>-</div><div>DIAGRAMA CONEXIUNI INSTRUMENTATIE</div><div>Pag.6/7</div></div></div> | |
| WH ALB BK NEGRU | | | |

PANOU LOCAL PL-AMC

EXE

21

| | |
|----|--------|
| 27 | WH 1 |
| 28 | WH 2 |
| 29 | WH 3 |
| 30 | WH 4 |
| 31 | WH 5 |
| 32 | WH COM |

| | |
|--|--------|
| Defect CB insotitori electrici | XI-001 |
| Defect rele curent insotitori electrici | XI-002 |
| Defect alimentare UPS | XI-003 |
| Defect intern UPS | XI-004 |
| Stare buton Oprire urgenta intreruptor general | XI-100 |

C-X-004
6 x 1 mm²

XI 2



| | | |
|-----|----|----|
| 1 | WH | 39 |
| 2 | WH | 40 |
| 3 | WH | 41 |
| 4 | WH | 42 |
| 5 | WH | 43 |
| 6 | WH | 44 |
| COM | WH | 45 |
| | | 46 |

01

TE TABLOU ELECTRIC

EE-X-E



| | | | | | | | | | | |
|--------------------------------------|---|------------------------|--|--|----------------|---------|-------------------|-----------|-------|--|
| COD CULORI WH ALB BK NEGRU | | | | | | | | | | |
| | 01 | Emis pentru Construire | | | | 03.2019 | M. PANTILICA | M. SCURTU | | |
| | 00 | Prima revizie | | | | 12.2018 | M. PANTILICA | M. SCURTU | | |
| | Rev. | Denumirea modificarii | | | | Data | Intocmit | Verificat | | |
| |  RIA ENGINEERING & CONSULTING 107065 BERECA, SAT BERECA, 812 100075, PLOESTI, IL CARAGALE 43 TELEFON: 0214 441 187 e-mail: office@riaengineering.ro Engineering & Consulting | |  CONPET S.A. Str. Anul 1948, nr. 1-3, 100557, PLOESTI. | | Nr. proiect | | Desen - Nr. | | Rev. | |
| | | | | | B.031.007 | | IN-WCD-206 | | 01 | |
| | Beneficiar | | CONPET S.A. | | | | Specialitate doc. | | F | |
| | Instalatie | | STATIE DE POMPARE POTLOGI | | | | INSTRUMENTATIE | | 3 | |
| | Scara | | | | Denumire desen | | | | FAZA | |
| | - | | DIAGRAMA CONEXIUNI INSTRUMENTATIE | | Pag. 7/7 | | | | PT.00 | |